

Inspection Report

Prepared For John & Mary Smith

Property Address

1234 M33, Alger, MI 48610







CLIENT INFORMATION							
Client:	John & Mary Smith	Telephone:	989-999-9999				
Email:		Additional:					

	PROPERTY INFORMATION
Property Address:	1234 M33
Property City:	Alger
Property ZipCode:	48610
Square Footage:	1950

INSPECTION SERVICE INFORMATION

Additional Service:	
Additional Service:	
Additional Service:	
Component:	

	INSPECTION DATE	INFORMATION	
Inspection Date:	7/23/2023	Inspection Time :	1300
Buyers Agent:			
Company:			

INSPECTION FEES							
Total Inspection Fee: \$295.00							
Payment Method:							

Your Inspection Report Should Be Available Within 24 hours At The Link Below https://wahlinspections.com/reports/202307232/202307232_Smith.pdf



989-980-9870

"Shield yourself from the unknown with a Wahl Home Inspection"

THIS CONTRACT LIMITS OUR LIABILITY... PLEASE READ CAREFULLY

~					
(- I	ΠΟ	nt	Na	me	
	пс	111	110	IIIC	

Inspection Address: 1234 M33

City: Alger

Zipcode: 48610

Invoice Number: 202307232

I (Client) hereby request a limited visual inspection of the structure at the above address to be conducted by Wahl Home Inspection Service LLC for my sole use and benefit. I warrant that I will read the following agreement carefully. I understand that this is a legal contract and that I am bound by all the terms contained herein.

John & Mary Smith

Initial	Here	X
---------	------	---

SCOPE OF INSPECTION

Х

The scope of the inspection and report is a limited visual inspection of the general systems and components of the home to identify any system or component listed in the report which may be in need of immediate major repair. This inspection will be performed in compliance with all Michigan State Home Inspection standards and practices.

OUTSIDE THE SCOPE OF THE INSPECTION

Anything not specifically mentioned below and or any area which is not exposed to view, is concealed, or is inaccessible because of soil, walls, floors, carpets, ceilings, furnishings, or any other thing that is not included in this inspection.

The inspection does not include any destructive testing or dismantling. The client agrees to assume all risk for all conditions which are concealed from view at the time of the inspection.

This is not a home warranty, guarantee, insurance policy, or substitute for real estate transfer disclosure which may be required by law.

Whether or not they are concealed, the following ARE OUTSIDE THE SCOPE OF THIS INSPECTION:

Building code or zoning ordinance violations. Geologic stability or soils condition. Structural stability or engineering analysis. Termites, pests, or other wood destroying organisms. Asbestos, radon, formaldehyde, lead, or air quality, electromagnetic radiation, or any other environmental hazards. Building value appraisal or cost estimates. Pools and spas bodies and underground piping. Specific components noted as neing excluded on the individual system inspection forms. Private water or private sewage systems. Saunas, steam baths, or fixtures and equipment Radio-controlled devices, automatic gates, elevators, lifts, dumbwaiters and thermostatic or time clock controls. Water softener/purifier systems or solar heating systems. Furnace heat exchangers, free standing appliances, security alarms, or personal property.

Adequacy or efficiency of any system or component.

Your inspector is a licensed builder, and is not acting as a licensed engineer. If your insepector recommends consulting other specialized experts, client must do so at client's expense.

I have read and agree to the above Scope of Inspection

Initial Here X _____ X _

ARBITRATION: Any dispute concerning the interpretation of this agreement or arising from this inspection and report, except one for inspection and payment shall be resolved informally between the parties or by arbitration conducted in accordance with the rules of the recognized Arbitration Association except that the parties shall select an arbitrator who is familiar with the home inspection industry. The arbitrator shall conduct summary judgement motions and enforce full discovery rights as a court would as provided in civil preceedings by legal code.

USE BY OTHERS: Client promises inspector that the client has requested this inspection for client's own use and will not disclose any part of the inspection report to any other person with these exceptions ONLY: One copy may be provided to the current seller(s) of the property for their use as part of this transaction only, and one copy may be provided to the real estate agent representing Client and/or bank or other lender for use in Clint's transaction only.

ATTORNEY'S FEES: The prevailing party in any dispute arising out of this agreement, the inspection, or report(s) shall be awarded all attorney's fees, arbitrator and other costs.

SEVERABILITY: Client and inspector agree that should a court of Competent Jurisdiction determine and declare that any portion of this contract is void, voidable, or unenforceable, the remaining provisions and portions shall remain in full force and effect.

LIMITATION ON LIABILITY

INSPECTOR'S LIABILITY FOR MISTAKES OR OMISSIONS IN THIS INSPECTION REPORT IS LIMITED TO THE FEE PAID FOR THIS INSPECTION REPORT. THE LIABILITY OF THE INSPECTOR'S PRINCIPALS, AGENTS, AND EMPLOYEES IS ALSO LIMITED TO THE FEE PAID. THIS LIMITATION APPLIES TO ANYONE WHO IS DAMAGED OR HAS TO PAY EXPENSES OF ANY KIND BECAUSE OF MISTAKES OR OMISSIONS IN THIS INSPECTION REPORT. THIS LIABILITY LIMITATION IS BINDING ON CLIENT AND CLIENT'S SPOUSE(S), HEIRS, PRINCIPALS, ASSIGNS, AND ANYONE ELSE WHO MAY OTHERWISE CALIM THROUGH CLIENT. CLIENT ASSUMES THE RISK OF ALL LOSSES GREATER THAN THE FEE PAID FOR THE INSPECTION. CLIENT AGREES TO IMMEDIATELY ACCEPT A REFUND OF THE FEE AS FULL SETTLEMENT OF ANY AND ALL CLAIMS WHICH MAY EVER ARISE FROM THIS INSPECTION.

BASIC INSPECTION FEE \$	295.00
OTHER INSPECTION FEES \$	0.00
TOTAL INSPECTION FEE \$	\$295.00

I have read, understand, and agree to all of the terms and conditions of this contract and agree to pay the fee listed above.

Signed:	X	Dated:
Signed:		Dated:





Please Read Page 3

ROOF / ATTIC - IMPORTANT INFORMATION PLEASE READ

(A) Manufacturers of asphalt shingles, on average, provide a twenty year warranty. This should not be confused with actual roof life. Actual roof life may vary greatly depending upon many factors. (B) It is advised that cash reserves be set aside for repairs or eventual replacement. It is recommended that no more than 2 layers of roofing lie on the roof. (C) Check flashing annually. (D) To prevents water damage to roof, sheathing, walls, ceilings, and structural members, gutters and downspouts must be kept clean and free of debris. It is suggested that you periodically check to ensure that all is functioning properly. (E) Local regulations in some communities require the presence of a flue liner when using certain fuels. Consult your local authorities. (F) Chimney should be sealed to extend it's life. (G) Attic ventilation is an important factor in the life expectancy of roofing materials. Maximum airflow must be maintained to minimize heat build up during warmer months, and condensation in the winter. DO NOT COVER OR BLOCK VENTS. (H) Insulation standards have have changed in recent years contact your local building code authority to determine the requirements for your area. (I) the presence of Urea Foam Formaldehyde Insulation in walls cannot be determined by visual inspection. We recommend an air quality test when the inspector suspects this type of insulation. (J) The evidence, source or amount of water penetration may not always be observable at the time of inspection. We suggest you consult the owner for historical perspective of whether

BUILDING EXTERIOR - IMPORTANT INFORMATION PLEASE READ

(A) Window wells should be cleaned annually. (B) Exterior faucets, if they are not of the frost free variety, should be drained during the colder months to prevent freezing. (C) The underside of porches and decks not accessible at the time of this inspection, should be made accessible to check for damage, rot, or infestation. (D) You should verify the age of the roofing materials through the broker, owner, or contractor. (E) Wood contacting the ground is conducive to rot, and wood destroying organisms, therefor it should be removed, or maintained.

GARAGE - IMPORTANT INFORMATION PLEASE READ

(A) Fume barriers, firegrade sheetrock, and fire doors are required in new construction. For safety, if your attached garage does not have these features you should consider adding them.

BUILDING FOUNDATION - IMPORTANT INFORMATION PLEASE READ

(A) Minor cracks in basement walls and floors represent normal shrinkage. To reduce the chance of water penetration, you can patch these with hydraulic cement. (B) Cracks that are offset or 'V' shaped represent differential settlement. To Determine if movement is continuous, consult owner or professional for history. (C) Examination of structural members, walls, floors, ceilings, wiring, piping, etc., cannot be conducted. These are partially finished, rendering them inaccessible. No destructive probing or removal of permanent or non-permanent partitions or tiles is performed. (D) Efflorescence is the white powdery substance often evident on concrete floors and walls. It is usually an indication that water penetration has occurred at some time. (E) Proper ventilation is necessary to reduce moisture in crawlspaces. If vents are blocked in colder months, they must be re-opened when the weather warms up. (F) Sump Pumps and sump discharge lines should periodically be inspected for proper operation.

HVAC - IMPORTANT INFORMATION PLEASE READ

(A) This report indicates the condition of the heat plant on the day of inspection without reqard to life expectancy; therefor we suggest that you obtain a major service policy for the heat plant from a dealer or contractor which whould include annual servicing, adjustments, efficiency testing, warranty and emergency service. (B) In the event that the unit is a coal conversion furnace/boiler, it is at the end of it's economical usefullness. Expect repairs or replacement. (C) To determine the condition of the heat exchanger in Forced Air Units, major disassembly by an HVAC technician is required. THIS REPORT DOES NOT REPRESENT THE CONDITION OF THE HEAT EXCHANGER and we recommend that you have this evaluated. DEFECTS IN THE HEAT EXCHANGER MAY REQUIRE REPLACEMENT OF THE ENTIRE FURNACE. (D) Relief valves, valves, gauges, switches, and other safety devices cannot be tested. (E) Asbestos insulation should be removed or encapsulated by a licensed Asbestos contractor. (F) All combustible materials must be kept clear of electric baseboard heating units. (G) Air conditioning equipment cannot be operated below 65 degrees. (H) Annual servicing of HVAC equipment is

PLUMBING / ELECTRICAL - IMPORTANT INFORMATION PLEASE READ

(A) The current main fuse capacity is not always an indication of it's maximum capacity. Consult with an electrician. (B) Due to the age of the structure, fixtures may not meet current standards, therefor updates to electrical and plumbing fixtures may be necessary when making renovations or repairs. (C) If your home has battery powered smoke and or carbon monoxide detectors, you should change batteries twice a year. We recommend that you replace the batteries each time your reset your clocks for daylight savings time. (D) GFCI Breakers and receptacles should be checked monthly for proper operation. (E) The inspection information on this page makes no representation as to the condition of private water supply and waste systems. There is optional testing which can provide this information. (F) Representations as to functionality of private water conditioning equipment are outside the scope of this inspection. Contact dealer for specific information. (G) On a semi-annual basis 2 - 3 gallons of water should be drained from the drain valve of the water heater. This will help to reduce sediment build up making future replacement easier.

BATHROOM - IMPORTANT INFORMATION PLEASE READ

(A) Cracking of grout lines between tiles is normal and due to shrinkage. In order to prevent staining grout lines should be sealed every 6 months. (B) We do not recommend using a garbage disposal if your home has a septic system, as this can cause blockages. (C) GFCI receptacles are advised any place occupants might come in contact with water. (D) Proper ventilation is important in areas of high moisture. Always use fan or open a window during a shower/bath, as this will help to reduce mold and mildew growth. (E) Improper maintenance of grout and caulking can result in moisture penetration causing severe structural damage. (F) This inspection only reports structural or mechanical defects. Cosmetic blemishes are outside the scope of this inspection.

BUILDING INTERIOR - IMPORTANT INFORMATION PLEASE READ

(A) It is recommended that all structures built prior to 1978 be tested for lead based paint. (B) Due to the nature of the deficiency, insulated windows and skylights may have undetected broken thermal seals. (C) Fireplaces and wood/coal burning stoves are visually inspected only. We recommed that chimneys and stove pipes are inspected annually and cleaned as necessary. It is further recommended that gas logs are inspected annually for proper

KITCHEN - IMPORTANT INFORMATION PLEASE READ

(A) Cracking of grout lines between tiles is normal and due to shrinkage. In order to prevent staining grout lines should be sealed every 6 months. (B) We do not recommend using a garbage disposal if your home has a septic system, as this can cause blockages. (C) GFCI receptacles are advised any place occupants might come in contact with water. (D) refrigerators and freezers are outside the scope of this inspection and no representations are made as to their functionality. (F) Unless otherwise noted, all inspected appliances are functional on the date of inspection. This does not however represent a guarantee or warranty. We are not making any representations as to future functionality or failure.



Maintenance, repair, or upgrade is recommended	Caution is advised as this item is not functioning properly at this time				
Item Appears Serviceable at this tim	This item does not exist / was not inpected at this time				
	FURTHER EVALUATION BY A LICENSED INDIVIDUAL IS RECOMMENDED				
Roof					
1. Roof Condition	There was moss build up on much of the roof. Along with the damaged/Deteriorate				
Roof Type Combination					
Roof Material Shingles - Asphalt					
Inspection Method: Walked					
2. Exterior Of Chimney	Damaged / Deteriorated Chimney Material				
Note: Flue Liner Excluded From Inspection					
3. Flashing	X Mastec / Tar Covered				
4. Skylights					
5. Gutters X					
Additional Information					

There was moss build up on much of the roof. Along with the damaged/Deteriorated concrete blocks near chimney cap. the chimney cap was cracked. The flashing at the chimney is improper. It should have step flashing.







IMPORTANT INFORMATION PLEASE READ CAREFULLY

(A) Manufacturers of asphalt shingles, on average, provide a twenty-year warranty. This should not be confused with actual roof life. Actual roof life may vary greatly depending upon many factors. (B) It is advised that cash reserves be set aside for repairs or eventual replacement. It is recommended that no more than 2 layers of roofing lie on the roof. © Check flashing annually. (D) To prevents water damage to roof, sheathing, walls, ceilings, and structural members, gutters and downspouts must be kept clean and free of debris. It is suggested that you periodically check to ensure that all is functioning properly. € Local regulations in some communities require the presence of a flue liner when using certain fuels. Consult your local authorities. (F) Chimney should be sealed to extend its life. (G) Attic ventilation is an important factor in the life expectancy of roofing materials. Maximum airflow must be maintained to minimize heat build-up during warmer months, and condensation in the winter. Do not cover or block vents.



Maintenance, repair, or upgrade is recommended						Cau	tior	n is advised as this item is not functioning properly at this time
Item Appears Serviceable at this time						-	This	item does not exist / was not inpected at this time
Rem Appears Serviceable at this time						I	FURTHER EVALUATION BY A LICENSED INDIVIDUAL IS RECOMMENDED	
1.	Exterior Siding (M	etal)	x					Wrinkled / Warped / Bowed
2.	Exterior Trim (M	etal)	x	F	H		H	
5.	Perimeter Drainage a	nd Grading	П	x	H		H	Improperly Sloped Toward Structure. Evidence of errosion
			x	F	H		H	
	Window Wolls		П	F	П	X	Ы	
8.	Exterior Foundation			x	П		П	Crack(s) - Minor
9.			x		П		П	
10.		ry	X		П		П	
	Eutorian Outlate		X	Г	П		П	
12.	Extorior Lighting			X				Porch light did not come on.
13.	Walkways Type					X		
14. Driveways Type (Dirt / Sand)								
15.	Exterior Doors							
	Front	(Wood)	x					
	Side	(Wood)	X					Walk-out basement door
	Rear - Leading to 3 se	e (Metal)	\Box	X	П		\square	Does Not Lock
			\Box		П		\square	
16.	Attached Porch / Dec	k / Stairs						
	Front	(Masonry - Concrete)		X				Crack(s) - Minor. Parft of nosing broken away. Slopes to the right
17.	Patio(s)	(Masonry - Tile)	X					3 season porch on rear of house
18.	Retaining Walls	(Combination - Stone /		X				Damaged / Deteriorated
19.	Vegitation			X				Overhanging Structure (Prune So That No Branch Is Within 10 Feet Of Roof)
20.	Fencing					X		
Ado	ditional Information							I
Th	ere is substantial slopi	ng of the grading toward t	he h		e Tr	nis si	noul	d be remedied in order to try to limit water entry into the basement.

BUILDING EXTERIOR



IMPORTANT INFORMATION PLEASE READ CAREFULLY

(A) Window wells should be cleaned annually. (B) Exterior faucets, if they are not of the frost free variety, should be drained during the colder months to prevent freezing. (C) The underside of porches and decks not accessible at the time of this inspection, should be made accessible to check for damage, rot, or infestation. (D) You should verify the age of the roofing materials through the broker, owner, or contractor. (E) Wood contacting the ground is conducive to rot, and wood destroying organisms, therefor it should be isolated, or maintained.

GARAGE



"Shield yourself from the unknown with a Wahl Home Inspection"

Maintenance, repair, or upgrade is recommended	Ca	auti	on is advised as this item is not functioning properly at this time		
Item Appears Serviceable at this time			is item does not exist / was not inpected at this time		
			FURTHER EVALUATION BY A LICENSED INDIVIDUAL IS RECOMMENDED		
GARAGE: Type Attached					
1. Roof Type Shingles - Composite		٦٢	Moss covered indicating a state of constant moisture. This will ultimately reduce th		
2. How_Viewed Walked					
3. Siding Material Metal					
4. Trim Material Metal					
5. Framing Method Conventional Framing					
6. Floor Type Concrete			Crack(s) - Moderate. Floor slopes enough that there are oepnings between the doc		
7. Finished Walls		x			
8. Finished Ceilings			Panels missing		
9. Windows					
10. Door 1 Type Over Head Door X			Door does not properly meet floor		
Location Front					
Material Fiberglass					
11. Door 1 Automatic Opener		•			
12. Door 1 Opener Safety Controls					
13. Door 2 Type:		×			
Location:					
Material:					
Door 2 Automatic Opener					
Door 2 Opener Safety Controls					
14. Door 3 Type:					
Location:					
Material:					
Door 3 Automatic Opener					
Door 3 Opener Safety Controls					
15. Door 4 Type:					
Location:					
Material:					
Door 4 Automatic Opener					
Door 4 Opener Safety Controls					
16. Electrical					
17. Other Item					
18. Fire Wall		x	Could Not Verify Existance		
Additional Information					
There appears to be a settling crack on the North West foundation wall.					





IMPORTANT INFORMATION PLEASE READ CAREFULLY

(A) Fume barriers, fire-grade sheetrock, and fire doors are required in new construction. For safety, if your attached garage does not have these features you should consider adding them.



	Maintenance, repair, or upgrade is recommended	d	Caution is advised as this item is not functioning properly at this time									
	Item Appears Serviceable at this time		This item does not exist / was not inpected at this time									
				I	FURTHER EVALUATION BY A LICENSED INDIVIDUAL IS RECOMMENDED							
At	tic											
1.	Attic Inspection:											
	Opening None											
	How Viewed No Accesss NOT INSPECTED				No Access							
2.	Roof Backings:											
	Material:											
3.	Roof Framing											
	Method:											
4.	Chimney											
5.	Ventilation											
	Method:											
6.	Insulation											
	Depth:											
	Material:											
7.	Whole House Fan											
8.	Attic Water Penetration											
Ac	Iditional Information											

I was unable to access the attic to verify framing. I tried looking through the gable end vents, but they offered no view either.

IMPORTANT INFORMATION PLEASE READ CAREFULLY

(A) Attic ventilation is an important factor in the life expectancy of roofing materials. Maximum airflow must be maintained to minimize heat buildup during warmer months, and condensation in the winter. DO NOT COVER OR BLOCK VENTS. (B) Insulation standards have changed in recent years contact your local building code authority to determine the requirements for your area. © the presence of Urea Foam Formaldehyde Insulation in walls cannot be determined by visual inspection. We recommend an air quality test when the inspector suspects this type of insulation. (D) The evidence, source or amount of water penetration may not always be observable at the time of inspection. We suggest you consult the owner for historical perspective of whether water penetration has been noted.

FOUNDATION



"Shield yourself from the unknown with a Wahl Home Inspection"

	Maintenanc	e, repair, or upgrade is reco	mmenc	led		Cau	tion	n is advised as this item is not functioning properly at this time					
	Itom Annoar	s Serviceable at this	time	This item does not exist / was not inpected at this time									
		S Del viceable at tills	ume			FURTHER EVALUATION BY A LICENSED INDIVIDUAL IS RECOMMENDED							
вu	ILDING FOUND	ATION											
1.	Туре	Basement											
2.	How Viewed	Entered											
3.	Foundation	Brick / Block					X	The measurement from the finished basement floor to the first floor joists is 79 5/8"					
4.	Door / Cover		X										
5.	Floor		X					Crack(s) - Minor					
6.	Windows					X		could not inspect function, as plastic is covering window.					
7.	Stairs		x					while functional, stairs are not up to current standards.					
8.	Handrails			X				Railing(s) - Improper Height					
9.	Electrical			X				Missing GFCI Protection & 2 prong outlets. No GFCI protection.					
10.	Support Beam				х			Part of the basement has an iron beam. Part by stairs has improper support beam.					
11.	Columns		X										
12.	Joists		X										
13.	Wall Framing					X							
14.	Chimney					X							
15.	Ventilation					X							
16.	Sump Pump					X							
17.	Water penetration	on and dampness			X			Moisture_Noted					
Ade	ditional Informat	ion						1					

The measurement from the finished basement floor to the first floor joists is 79 5/8". That is less than the standard 80" doorway.

There is an area of the foundation wall that is covered with insulation board. None of the other walls have this covering. This foundation wall is on the other side of the deteriorated retaining walls. I worry the insulation board could be covering foundation damage. Standing water all along South West wall. This correesponds to an area of improper grading on the font of the house. The main support beam rinning perpendicular to the basement stairs does not meet modern standards.







IMPORTANT INFORMATION PLEASE READ CAREFULLY

(A) Minor cracks in basement walls and floors represent normal shrinkage. To reduce the chance of water penetration, you can patch these with hydraulic cement. (B) Cracks that are offset or 'V' shaped represent differential settlement. To Determine if movement is continuous, consult owner or professional for history. (C) Examination of structural members, walls, floors, ceilings, wiring, piping, etc., cannot be conducted. These are partially finished, rendering them inaccessible. No destructive probing or removal of permanent or non-permanent partitions or tiles is performed. (D) Efflorescence is the white powdery substance often evident on concrete floors and walls. It is usually an indication that water penetration has occurred at some time. (E) Proper ventilation is necessary to reduce moisture in crawlspaces. If vents are blocked in colder months, they must be re-opened when the weather warms up. (F) Sump Pumps and sump discharge lines should periodically be inspected for proper operation.


ELECTRICAL



"Shield yourself from the unknown with a Wahl Home Inspection"

Maintenance, repair, or upgrade is recomm	ende	ed	Caution is advised as this item is not functioning properly at this time								
Item Appears Serviceable at this tim	ne			Ĩ,		item does not exist / was not inpected at this time FURTHER EVALUATION BY A LICENSED INDIVIDUAL IS RECOMMENDED					
	1				L	FOR THER EVALUATION BY A LICENSED INDIVIDUAL IS RECOMMENDED					
ELECTRICAL SYSTEM											
1. Main Panel Basement	X										
2. Service Size 200 amp	X										
Main Disconnect Main Breaker Inside Panel											
3. Accessible Wiring	X					Some romex and some older cloth wrapped					
Material Copper											
Supply Size 120/240 Volt											
4. Sub Panel #1				X							
5. Sub Panel #2				X							
6. Sub Panel #3				X							
7. Smoke Detector(s)	X										
8. Carbon Monoxide Detector(s)				X							
Additional Information											

There is what appears to be an old water heater disconnect under the stairs adjacent to the water heater.

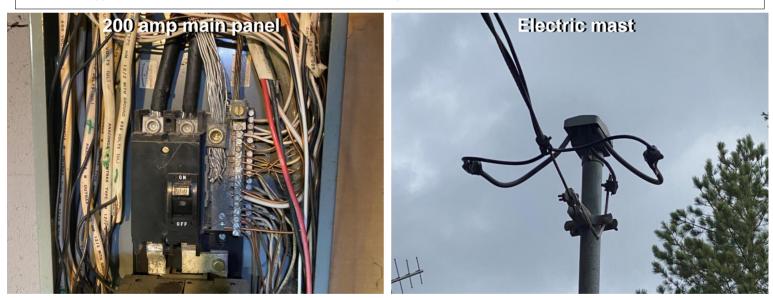



IMPORTANT INFORMATION PLEASE READ CAREFULLY

(A) The current main fuse capacity is not always an indication of its maximum capacity. Consult with an electrician. (B) Due to the age of the structure, fixtures may not meet current standards, therefor updates to electrical fixtures may be necessary when making renovations or repairs. © If your home has battery powered smoke and or carbon monoxide detectors, you should change batteries twice a year. We recommend that you replace the batteries each time your reset your clocks for daylight savings time. (D) GFCI Breakers and receptacles should be checked monthly for proper operation.



Maintenance, repair, or upgrade is recomme	ende	d	(Caution is advised as this item is not functioning properly at this time						
Item Appears Serviceable at this tin	no			This item does not exist / was not inpected at this time						
ten Appears der viceable at this th					FURTHER EVALUATION BY A LICENSED INDIVIDUAL IS RECOMMENDE					
X Unit # 1 Electric Baseboard - Electric	X					Each unit in each room was functional at time of inspection.				
1. Location All Interior Rooms										
2. General Controls	X									
3. Safety Controls				X						
4. Electric Disconnect				X						
5. Venting				X						
6. Piping				X						
7. Combustion				X						
8. Distribution				X						
9. Filter(s)				X						
10. Support				X						
Additional Information										

Additional Information

No Additional Information Entered

IMPORTANT INFORMATION PLEASE READ CAREFULLY

(A) This report indicates the condition of the heat plant on the day of inspection without reqard to life expectancy; therefor we suggest that you obtain a major service policy for the heat plant from a dealer or contractor which whould include annual servicing, adjustments, efficiency testing, warranty and emergency service. (B) In the event that the unit is a coal conversion furnace/boiler, it is at the end of it's economical usefullness. Expect repairs or replacement. (C) To determine the condition of the heat exchanger in Forced Air Units, major disassembly by an HVAC technician is required. THIS REPORT DOES NOT REPRESENT THE CONDITION OF THE HEAT EXCHANGER and we recommend that you have this evaluated. DEFECTS IN THE HEAT EXCHANGER MAY REQUIRE REPLACEMENT OF THE ENTIRE FURNACE. (D) Relief valves, valves, gauges, switches, and other safety devices cannot be tested. (E) Asbestos insulation should be removed or encapsulated by a licensed Asbestos contractor. (F) All combustible materials must be kept clear of electric baseboard heating units. (G) Air conditioning equipment cannot be operated below 65 degrees. (H) Annual servicing of HVAC equipment is recommended.

All Interior Rooms

PLUMBING



"Shield yourself from the unknown with a Wahl Home Inspection"

Maintenance, repair, or upgrade is recom	mende	ed	Caution is advised as this item is not functioning properly at this time									
Item Appears Serviceable at this ti	ime		This item does not exist / was not inpected at this time									
					I	FURTHER EVALUATION BY A LICENSED INDIVIDUAL IS RECOMMENDED						
PLUMBING SYSTEM												
Supply Type Private	_											
Waste Type Private	_											
1. Supply Lines Combination copper/plastic	X											
2. Drain Lines Combination Metal/PVC	X											
3. Main Vent Stack Metal	X											
4. Gas Supply				Х								
5. Water Heater Size 40 Gal	X					According to Rheem website, this unit was manufactured on 3/24/2020						
Fuel Electric	_											
6. Washer Hookup				Х		No washer hooked up. Piping exists. Not inspected						
7. Washer Drain Rigid		Х				Improper standpipe. Not currently being used						
8. Dryer Hookup Electric 240V				Х		Dryer power not on. Homeowner said I could not turn on breaker.						
9. Dryer Vent Rigid				Х		Dryer disconnected could not inspect.						
10. Sump Pump				X								
						1						

Additional Information

Hot and cold water lines are reversed on the basement laundry tub. The hot water ran for a short while, and then slowly stopped running. The cold worked well.





Hot an cold water reversed. Hot water slowed to a trickle.


IMPORTANT INFORMATION PLEASE READ CAREFULLY

(A) Due to the age of the structure, fixtures may not meet current standards, therefore updates to plumbing fixtures may be necessary when making renovations or repairs. (B) The inspection information on this page makes no representation as to the condition of private water supply and waste systems. There is optional testing which can provide this information. (C) Representations as to functionality of private water conditioning equipment are outside the scope of this inspection. Contact dealer for specific information. (D) On a semi-annual basis 2 - 3 gallons of water should be drained from the drain valve of the water heater. This will help to reduce sediment build up making future replacement easier.



Maintenance, repair, or upgrade is recomme	nde	d	Caution is advised as this item is not functioning properly at this time							
Item Appears Serviceable at this tin					This	item does not exist / was not inpected at this time				
						FURTHER EVALUATION BY A LICENSED INDIVIDUAL IS RECOMMENDED				
I. Sink / Vanity		х				Drain Lines - Improper "S" Trap				
2. Toilet	X									
3. Tub / Shower		Х				Tub stopper does not hold water. Tub drains slowly.				
I. Electrical		Х				Missing GFCI Protection *** SAFETY HAZARD ***				
5. Ceilings	Х	\square	Π	\square						
6. Walls		Х	Π	\square		Tub wall blocks door from opening fully.				
7. Floors	Х		Π	\square						
3. Windows	X									
9. Doors	Х									
0. Ventilation	X					Window only				
dditional Information										

No Additional Information Entered

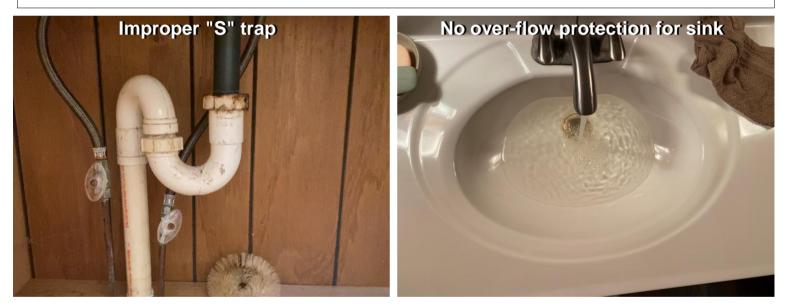

Hallway



(A) Cracking of grout lines between tiles is normal and due to shrinkage. In order to prevent staining grout lines should be sealed every 6 months. (B) We do not recommend using a garbage disposal if your home has a septic system, as this can cause blockages. © GFCI receptacles are advised any place occupants might come in contact with water. (D) Proper ventilation is important in areas of high moisture. Always use fan or open a window during a shower/bath, as this will help to reduce mold and mildew growth. € Improper maintenance of grout and caulking can result in moisture penetration causing severe structural damage. (F) This inspection only reports structural or mechanical defects. Cosmetic blemishes are outside the scope of this inspection.



"Shiel with a Wahl Home Inspection

	1st Floor North Corner	
d yourself from the unknown		
h a Wahl Home Inspection"		

Living Room

Maintenance, repair, or upgrade is recomm	nend	ed	Caution is advised as this item is not functioning properly at this time									
Item Appears Serviceable at this tin	ne		This item does not exist / was not inpected at this time									
Rem Appears berviceable at this th				FURTHER EVALUATION BY A LICENSED INDIVIDUAL IS RECOMMENDE								
1. Ceiling		X				Ceiling panels not properly fitted.						
2. Floor	X											
3. Walls	X											
4. Doors				X		Sliding Door Blocked By Furniture.						
5. Windows		Х				Glass Broken in right slider. Left slider does not lock.						
6. Electrical	X					Receptacle(s) - 2 Prong Outlets						
7. Ceiling Fan(s)				X								
8. Stairs / Railings		Π	Π	X								
9. Fireplace / Wood Stove		Х				Damper Damaged / Inoperative						
10. Smoke Detectors				X		Recommend Installation Of Smoke Detector(s)						
10. Carbon Monoxide Detectors				X		Recommend Replacement Of CO Detector(s)						
11. Closet(s)	X											
dditional Information												

No Additional Information Entered





(A) It is recommended that all structures built prior to 1978 be tested for lead based paint. (B) Due to the nature of the deficiency, insulated windows and skylights may have undetected broken thermal seals. © Fireplaces and wood/coal burning stoves are visually inspected only. We recommed that chimneys and stove pipes are inspected annually and cleaned as necessary. It is further recommended that gas logs are inspected annually for proper operation.



Maintenanc

Item Appears

Ceiling

Walls

Doors Windows

Electrical

Ceiling Fan(s) Stairs / Railings

10. Smoke Detectors

11. Closet(s) Additional Information

1. 2. Floor

3.

4.

5.

6.

7.

8.

9.

"Shield yourself from the unknown

spection						with a Wahl Home Inspection"							
e, repair, or upgrade is recomm	nend	ed	Caution is advised as this item is not functioning properly at this time										
Serviceable at this tim			This item does not exist / was not inpected at this time FURTHER EVALUATION BY A LICENSED INDIVIDUAL IS RECOMMENDED										
X													
		X	Н			Metal Slider Does Not Lock							

Receptacle(s) - 2 Prong Outlets

Recommend Installation Of Smoke Detector(s)

No Additional Information Entered

Fireplace / Wood Stove

10. Carbon Monoxide Detectors

IMPORTANT INFORMATION PLEASE READ CAREFULLY

(A) It is recommended that all structures built prior to 1978 be tested for lead based paint. (B) Due to the nature of the deficiency, insulated windows and skylights may have undetected broken thermal seals. © Fireplaces and wood/coal burning stoves are visually inspected only. We recommed that chimneys and stove pipes are inspected annually and cleaned as necessary. It is further recommended that gas logs are inspected annually for proper operation.

Х

Х

Х

Х Х

Х

X

Х

1st Floor NNE Side



1st Floor North East Corner



"Shield yourself from the unknown with a Wahl Home Inspection"

Maintenance, repair, or upgrade is recomm	nenc	led Caution is advised as this item is not functioning properly at this time									
Item Appears Serviceable at this tin	10			-	item does not exist / was not inpected at this time						
item Appears Serviceable at this th				FURTHER EVALUATION BY A LICENSED INDIVIDUAL IS RECOMMENDED							
1. Ceiling	x										
2. Floor	X										
3. Walls	X										
4. Doors	X					Accordian style door is functioning properly					
5. Windows	X										
6. Electrical	X					Receptacle(s) - 2 Prong Outlets					
7. Ceiling Fan(s)				X							
8. Stairs / Railings				X							
9. Fireplace / Wood Stove				X							
10. Smoke Detectors				X							
10. Carbon Monoxide Detectors				X							
11. Closet(s)	X										
dditional Information					1						
Sliding door to patio does not lock.											

IMPORTANT INFORMATION PLEASE READ CAREFULLY

Α

(A) It is recommended that all structures built prior to 1978 be tested for lead based paint. (B) Due to the nature of the deficiency, insulated windows and skylights may have undetected broken thermal seals. © Fireplaces and wood/coal burning stoves are visually inspected only. We recommed that chimneys and stove pipes are inspected annually and cleaned as necessary. It is further recommended that gas logs are inspected annually for proper operation.



Maintenance, repair, or upgrade is recomm	nenc	led	(Caution is advised as this item is not functioning properly at this time						
Item Appears Serviceable at this tin	00			This item does not exist / was not inpected at this time						
Rem Appears Serviceable at this th					I	FURTHER EVALUATION BY A LICENSED INDIVIDUAL IS RECOMMENDED				
1. Ceiling	x									
2. Floor	X									
3. Walls	X									
4. Doors				X						
5. Windows				X						
6. Electrical	X									
7. Ceiling Fan(s)				X						
8. Stairs / Railings				X						
9. Fireplace / Wood Stove				X						
10. Smoke Detectors	X									
10. Carbon Monoxide Detectors				X		Recommend Installation Of CO Detector(s)				
11. Closet(s)				X						
dditional Information										
No Additional Information Entered										

IMPORTANT INFORMATION PLEASE READ CAREFULLY

Α

(A) It is recommended that all structures built prior to 1978 be tested for lead based paint. (B) Due to the nature of the deficiency, insulated windows and skylights may have undetected broken thermal seals. © Fireplaces and wood/coal burning stoves are visually inspected only. We recommed that chimneys and stove pipes are inspected annually and cleaned as necessary. It is further recommended that gas logs are inspected annually for proper operation.

1st Floor



Maintenance, repair, or upgrade is recomm	nenc	led	(Caution is advised as this item is not functioning properly at this time						
Item Appears Serviceable at this tin	00			This item does not exist / was not inpected at this time						
Rem Appears Serviceable at this th					I	FURTHER EVALUATION BY A LICENSED INDIVIDUAL IS RECOMMENDED				
1. Ceiling	x									
2. Floor	X									
3. Walls	X									
4. Doors				X						
5. Windows				X						
6. Electrical	X									
7. Ceiling Fan(s)				X						
8. Stairs / Railings				X						
9. Fireplace / Wood Stove				X						
10. Smoke Detectors	X									
10. Carbon Monoxide Detectors				X		Recommend Installation Of CO Detector(s)				
11. Closet(s)				X						
dditional Information				•						
No Additional Information Entered										

IMPORTANT INFORMATION PLEASE READ CAREFULLY

Α

(A) It is recommended that all structures built prior to 1978 be tested for lead based paint. (B) Due to the nature of the deficiency, insulated windows and skylights may have undetected broken thermal seals. © Fireplaces and wood/coal burning stoves are visually inspected only. We recommed that chimneys and stove pipes are inspected annually and cleaned as necessary. It is further recommended that gas logs are inspected annually for proper operation.

1st Floor

Kitchen 1



"Shield yourself from the unknown with a Wahl Home Inspection"

Maintenance, repair, or upgrade is recomme	ed	Caι	itioi	n is advised as this item is not functioning properly at this time	
Item Appears Serviceable at this time				This	item does not exist / was not inpected at this time
item Appears der viceable at tins time					FURTHER EVALUATION BY A LICENSED INDIVIDUAL IS RECOMMENDED
1. Sink		x			Supply Stops - Missing
2. Counter	X				
3. Cabinets		Х			Bottom drawer does not have slides.
4. Ceilings	X				
5. Walls	X				
6. Floors	X				
7. Windows	X				
8. Doors	X				
9. Electrical		Х			Missing GFCI Protection at receptacles adjacent to the sink *** SAFETY HAZARD
10. Plumbing Under Sink	Χ				
11. Garbage Disposal			Х		
12. Stove / Oven	X				
13. Dishwasher			Х		
14. Trash Compacter			X		

Additional Information

Cabinet above sink is not properly secured to the wall and adjacent cabinets.



IMPORTANT INFORMATION PLEASE READ CAREFULLY

(A) Cracking of grout lines between tiles is normal and due to shrinkage. In order to prevent staining grout lines should be sealed every 6 months. (B) We do not recommend using a garbage disposal if your home has a septic system, as this can cause blockages. © GFCI receptacles are advised any place occupants might come in contact with water. (D) refrigerators and freezers are outside the scope of this inspection and no representations are made as to their functionality. (F) Unless otherwise noted, all inspected appliances are funtional on the date of inspection. This does not however represent a guarantee or warranty. We are not making any representations as to future functionality or failure.



Maintenance, repair, or upgrade is recommende	əd	С	auti	ion	is advised as this item is not functioning properly at this time
Item Appears Serviceable at this time			Т	⁻ his	item does not exist / was not inpected at this time
Rem Appears Serviceable at this time				F	FURTHER EVALUATION BY A LICENSED INDIVIDUAL IS RECOMMENDED
Septic System					
Septic System Age Seems original to houes					
Could Not Verify System Age					
Building Currently Occupied					
X Yes No					
Separate Drain / Dry Well					
Yes X No					
Well / Steam / Pond / Lake On Site					
X Yes No					
Isolation Distance					
From Well Opposite side of house Ft					
From Site Water > 60ft Ft					
Septic Tank X					Newly installed T and filter indicate repair after concrete baffle had evidently
Tank Location North side of structure					deteriorated.
Tank Capacity Size in dispute Appears to be a					
Tank Material Concrete					
Absorption System X					
System Location North side of structure					
Field Type Unknown					
Field Size According to the Septic Permit					
Over All System Operation					The permit was issued for System Failure
Additional Sentic Information				_	

The septic system appears to be funtiioning properly. There is some dispute as to the size of the tank, but regardless, it appears adequately sized for the structure.

Installing a filter on a septic system limits solids from entering the drain bed. Wh



IMPORTANT INFORMATION PLEASE READ CAREFULLY

(A) The septic system is basically a burried system which is hidden from normal visual inspection. Many possible problems may not show at time of inspection. (B) Bacteria is essential to your septic system as it breaks down solids, and allows your system to properly function. The use of bleach and or anti bacterial soaps are not recommended as they can kill this bacteria.



Maintenance, repair, or upgrade is recommended	Caution is advised as this item is not functioning properly at this time					
Item Appears Serviceable at this time	This item does not exist / was not inpected at this time FURTHER EVALUATION BY A LICENSED INDIVIDUAL IS RECOMMENDED					
Well Depth Verified Ft						
Verified By						
X Well Depth Not Verified						
Size Verified						
Casing Verified						
I. Well Pump						
Pump Type						
Manufacturer						
Size <u>HP</u>						
X Pressure 38 +- PSI						
X Flow 5 +- GPM						
2. Fittings and Connections						
3. Expansion Tank						

Additional Well Information

While, as a courtesy, inspector checked the pressure and flow rate of the water, Inspector did not perform and testing to the pump, pressure tank, or any part thereof. Inspector also did not perform any water quality analysis.

**** I MAKE NO STATEMENTS



Flow rate 5 gpm-with pump running



IMPORTANT INFORMATION PLEASE READ CAREFULLY

(A) The well is basically a burried system, therefor some of the system cannot be inspected. Uunless otherwise noted, the pump and tank are functioning properly at time of inspection. This inspection is in no way to be construed as a guarantee or waranty of future operation. We recommend testing water quality semi-annually. (B) the expansion tank pressurizes your system, so that the well pump does not have to run continuously thereby extending it's usefull life expectancy.